

WARNING - Unauthorized Hazardous Brake Pads in Circulation

Unauthorized spare part brake pads for the disc brake SBS2220H0 (Haldex DBT 22 LT) from SAF-HOLLAND have been found in the market. These copies have larger holes in the back plate of the brake pads, see Fig. 1 below, and do not provide the required amount of support to the projections on the thrust plate and whole mechanism as original SAF-HOLLAND spare parts.

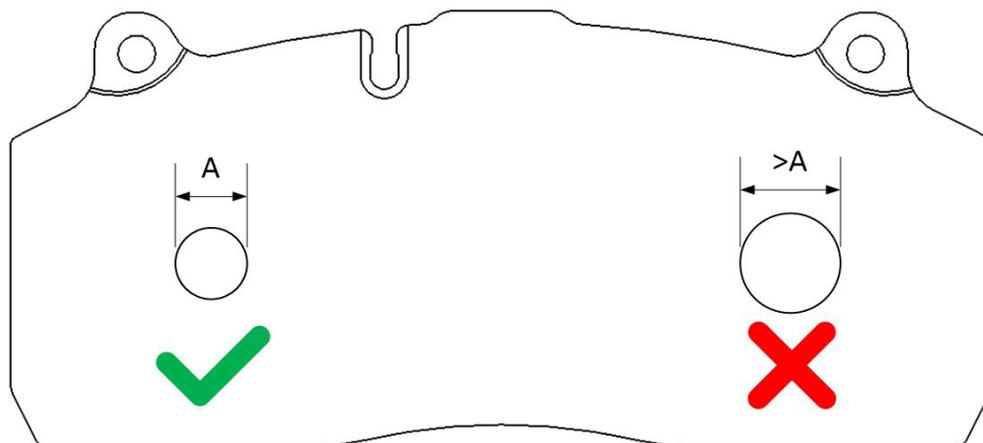


Fig. 1: A brake pad for the SBS2220H0 (Haldex DBT 22 LT) air disc brake is shown above. In the brake pad, the standard hole size is depicted to the left, and the enlarged hole is shown to the right.

SAF SBS2220H0 (Haldex DBT 22 LT) disc brakes equipped with unauthorized brake pads have in tests shown the acceleration of the thrust plate to be significantly higher, and have been found in failed brakes having broken follower pins. This can cause the disc brake to lose the ability to brake! If non-validated spare parts are fitted, this not only invalidates any product warranty but also jeopardises the safe operational function of the brake. If you have any questions do not hesitate to contact the SAF-HOLLAND Aftermarket Support under +49 (0) 6095-301-301.

Do not hesitate to contact SAF-HOLLAND should you be concerned about this issue or require further information. SAF-HOLLAND can also assist to ensure your vehicles are fitted with the correctly validated spare parts to ensure continual safe brake function operation.